

Document ID: 5162116

# #18-NA-346: Vehicle Will Not Start and/or Service Electronic Steering Column Lock System Message Displayed on Driver Information Center (DIC) - (Nov 14, 2018)

**Subject: Vehicle Will Not Start and/or Service Electronic Steering Column Lock System Message Displayed on Driver Information Center (DIC)**





**This Bulletin replaces PIC5367A. Please discard PIC5367A.**

Brand:	Model:	Model Year:		Breakpoint:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Corvette	2005	2005				Equipped with 6 Speed Manual Transmission (RPO MM6)

<b>Involved Region or Country</b>	North America and N.A. Export Regions
<b>Condition</b>	Some customers may comment on the vehicle not starting and/or a Service Electronic Steering Column Lock System message being displayed on the Driver Information Center (DIC). <b>Note:</b> The steering wheel may not turn when this condition occurs.
<b>Cause</b>	This condition may be caused by the electronic steering column module failing to send the correct signal to the BCM.
<b>Correction</b>	

© 2018 General Motors. All rights reserved.

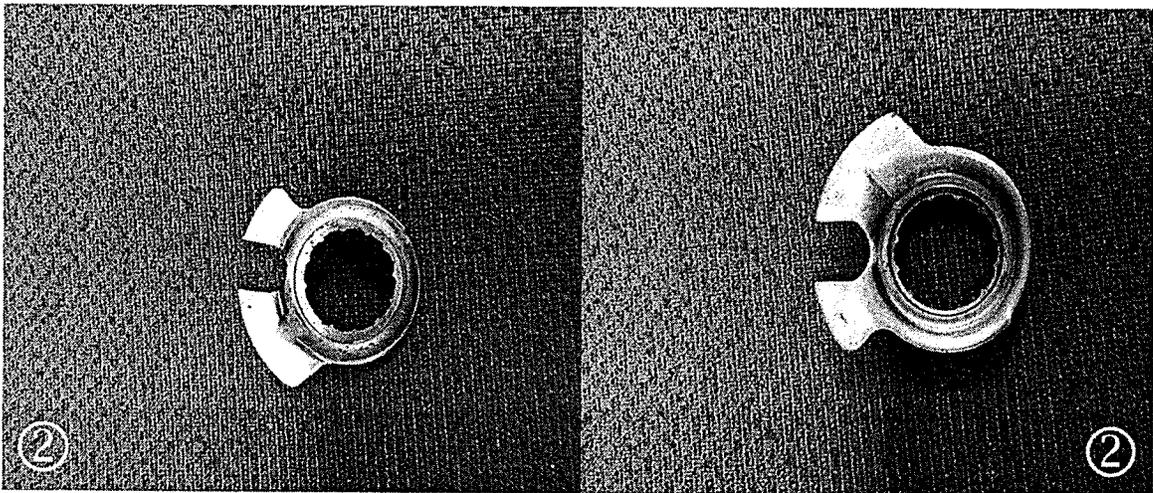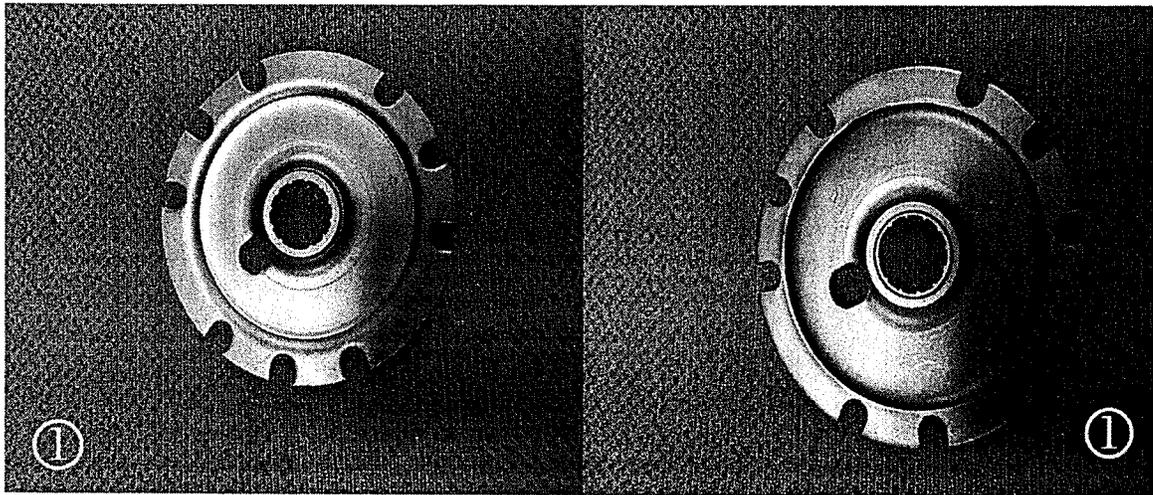

Replace the steering column lock plate (1) with the new plate (2), and update the BCM with the new utility file.

Service Programming System

Supported Controllers



Select Controller

- ABS Anti-Lock Braking System Control Module
- BCM Body Control Module - Utility to Disable Electronic Column Locking
- BrAC Heating, Ventilation, and Air Conditioning - Programming
- CMSE Cluster Module - Language Configuration
- PCMVCM Powertrain Vehicle Control Module - Programming
- RCCLR Remote Control Door Lock Release - Programming (Pass-Through)
- TQM Transmission Control Module
- VCM Vehicle Communication Interface Control Module - Subrate 16-25-44-101 Programming Only
- VTD Vehicle Theft Deterrent - Learn
- VTD Vehicle Theft Deterrent - Learn (Export Only)



Service Programming System

Calibration Selection

Body Control Module - Utility to Disable Electronic Column Locking

Control module

Calibration

Index  
of 15000533 Control module

History

Part Number	Description
15000533	disable electronic column locking



Service Programming System

Pre-Programming Instructions

Pre-Programming Instructions

You are about to electrically disable the electric steering column lock. You must also disable the mechanical aspect of the column lock.



The technician needs to electrically disable the electric steering column lock in the SPS menu.

**Important:** MUST use J 23653-SIR and J 42137 when installing the cam orientation plate and retaining ring. Failure to use these tools may result in damage to the cam orientation plate, retaining ring and/or steering column components.

**Note:** DO NOT reuse the original retaining ring.

**Note:** The customer needs to be informed that the locking feature will no longer work after the new plate has been installed.

**Parts Information**

Causal Part	Description	Part Number	Qty
X	PLATE, T/SIG SW CANC CAM POSN (W/SHIELD)	26049186	1
	RING, STRG SHF LK PLT RET	05694191	1

**Warranty Information**

Dealership personnel will need to inform the customer that this repair is **NOT** covered under warranty.

<b>Version</b>	1
<b>Modified</b>	Released November 14, 2018

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT  
VOLUNTARY  
TECHNICIAN  
CERTIFICATION